


HAM-ISI Unit #4 – Investigation Of Unusual HF Resonances/Noise

SEI-LHO


INITIAL CONFIGURATION:

Top Mass Sitting On Small Washers – 1 Small Washer Set On Optical Table Tracks

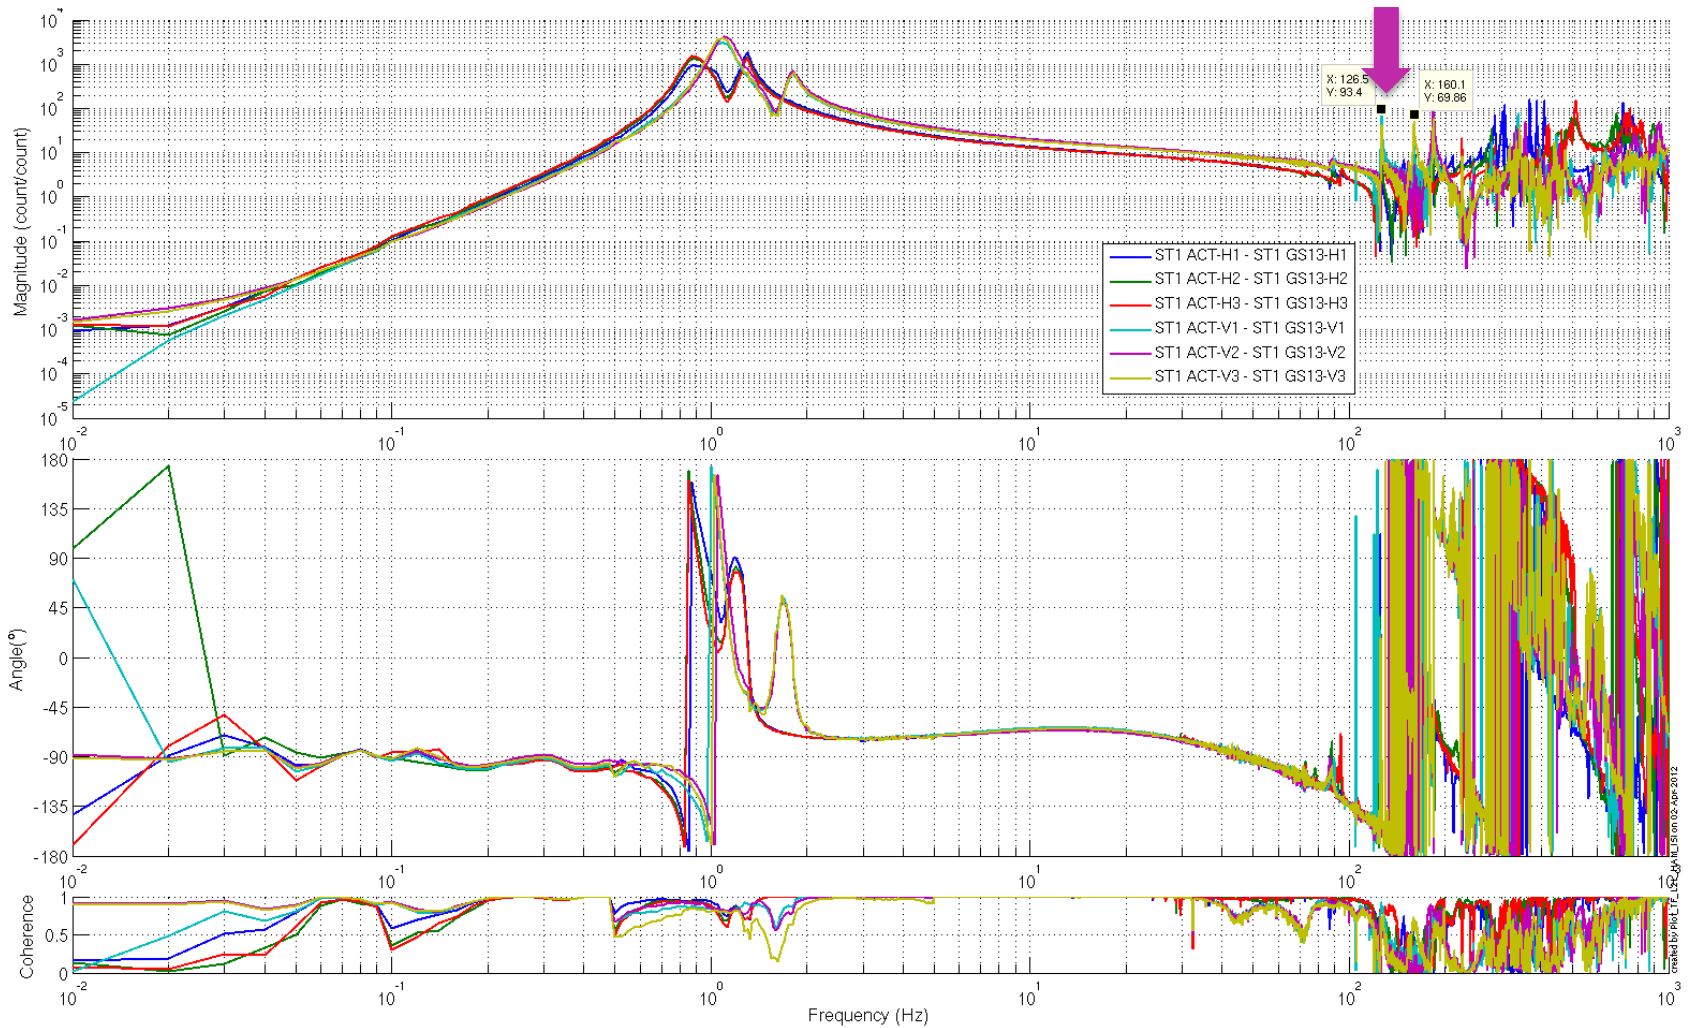


One can hear the top mass of the optical table ringing when being hit

Small Washers Removed And Replaced With Thicker Ones Which Were Set Away From The Optical Table Tracks

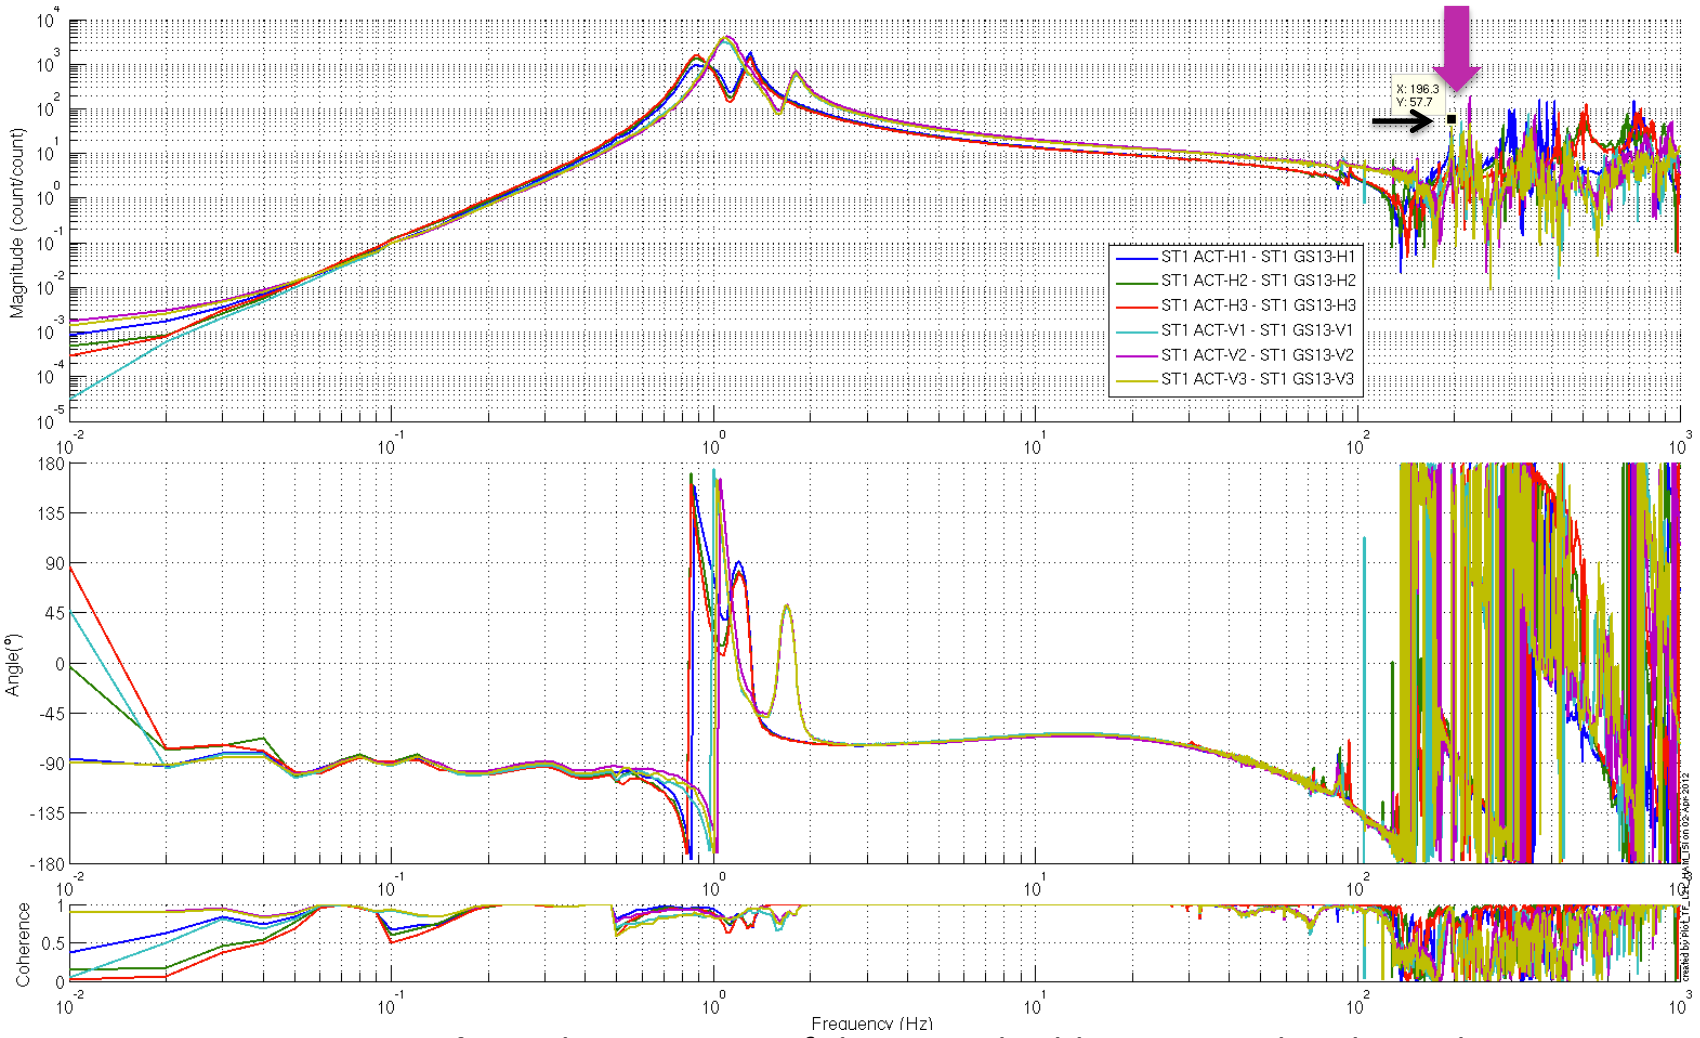


One can NOT hear the top mass of the optical table ringing when being hit


1 {Bolt + Washer} Found (And Removed) In The Vertical Hole Of The GS13 Door Of Corner #3

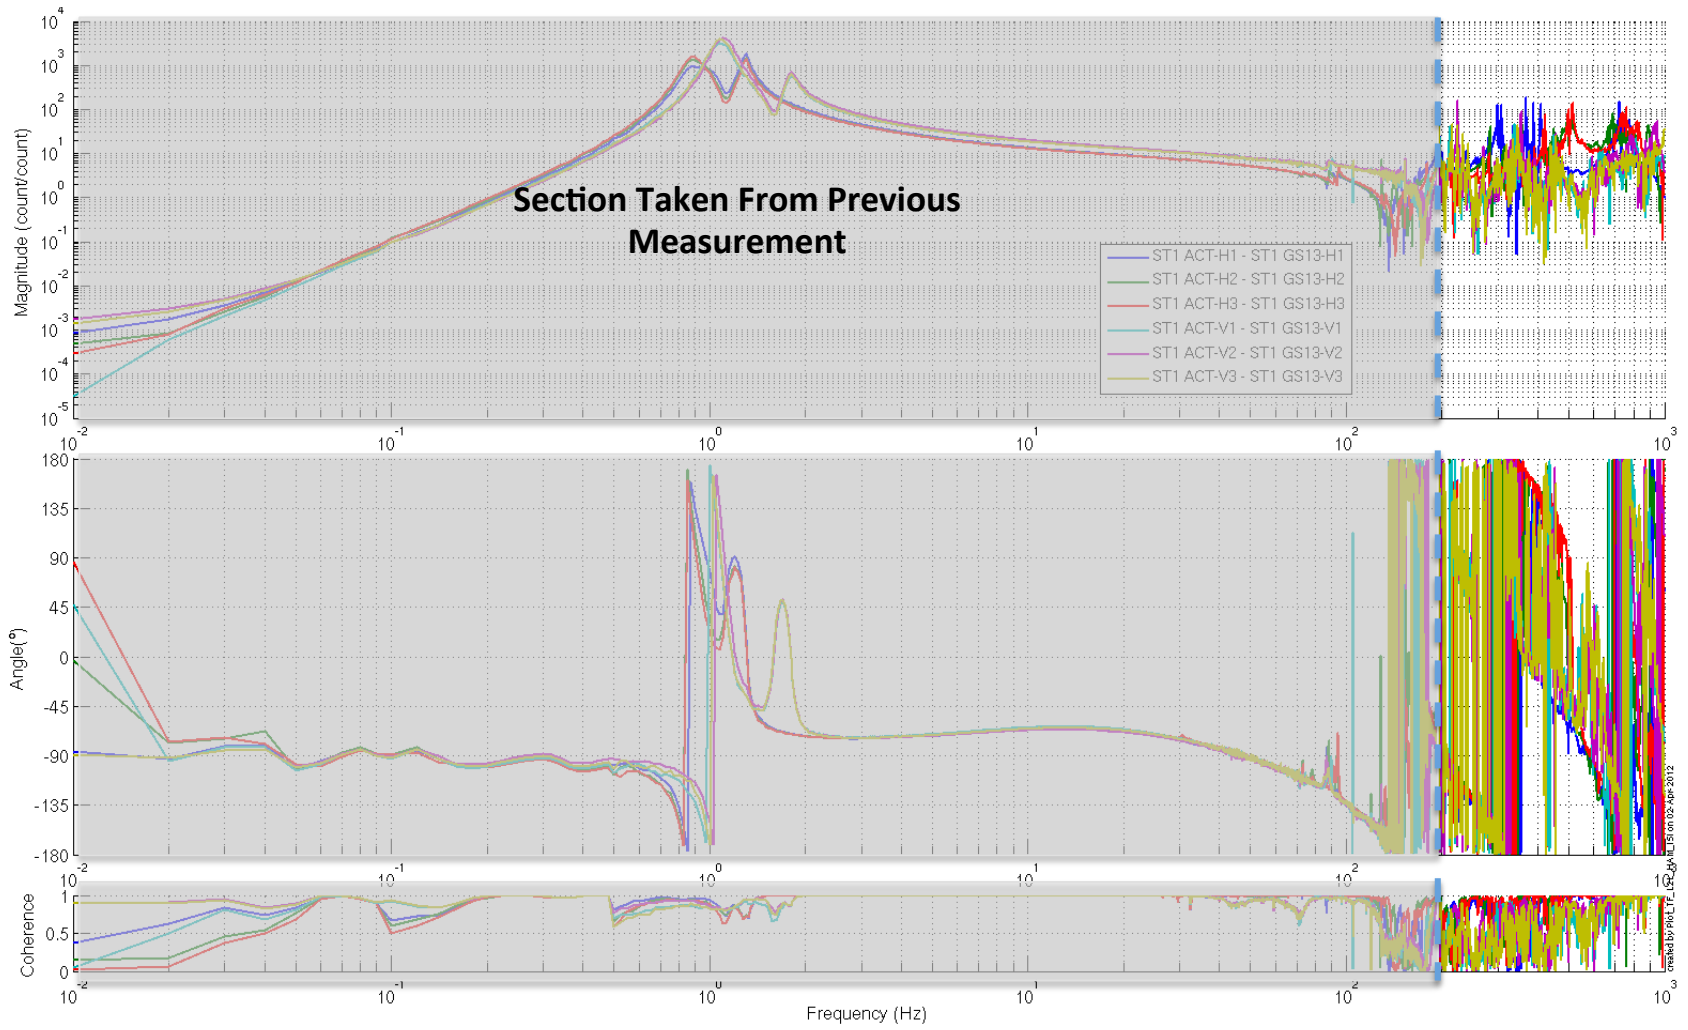

1 {Small Washer} Found (And Removed) On The Optical Table. Cable Of GS13-V3 Taken Away From Its Initial Position: Possibly Rubbing On Shielding Pigtail

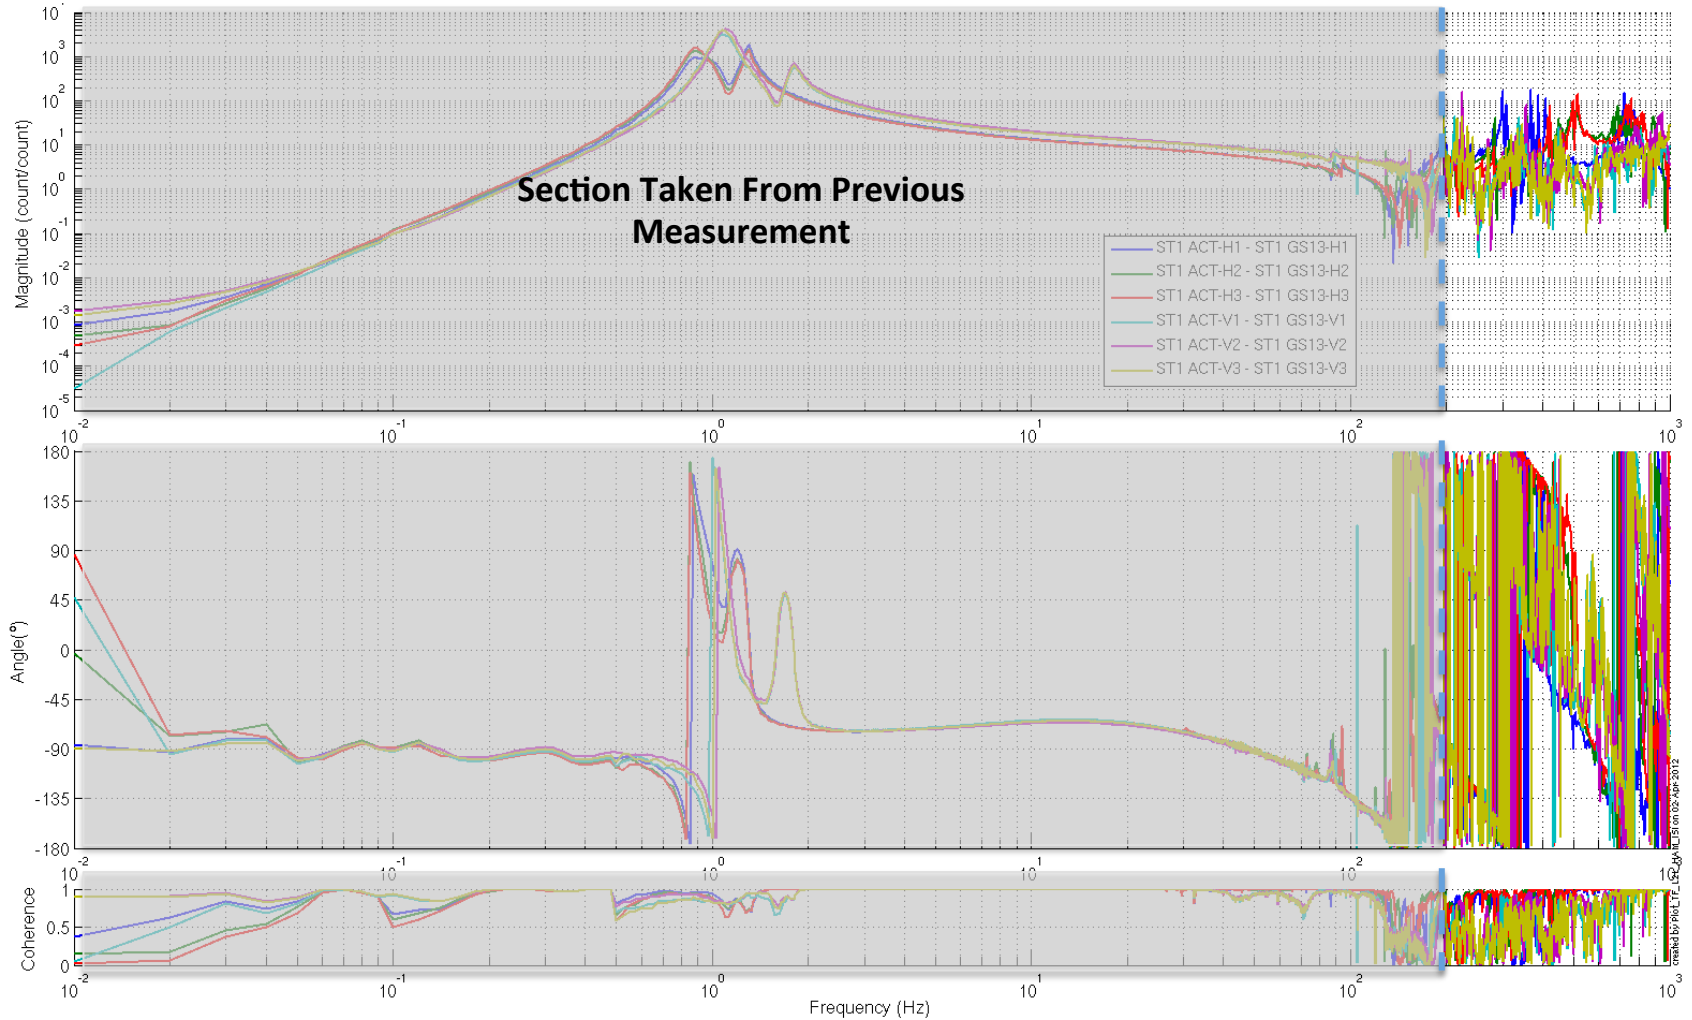

The Washers That Were Set Under the {5kg and 10kg Balancing Masses} Were Removed

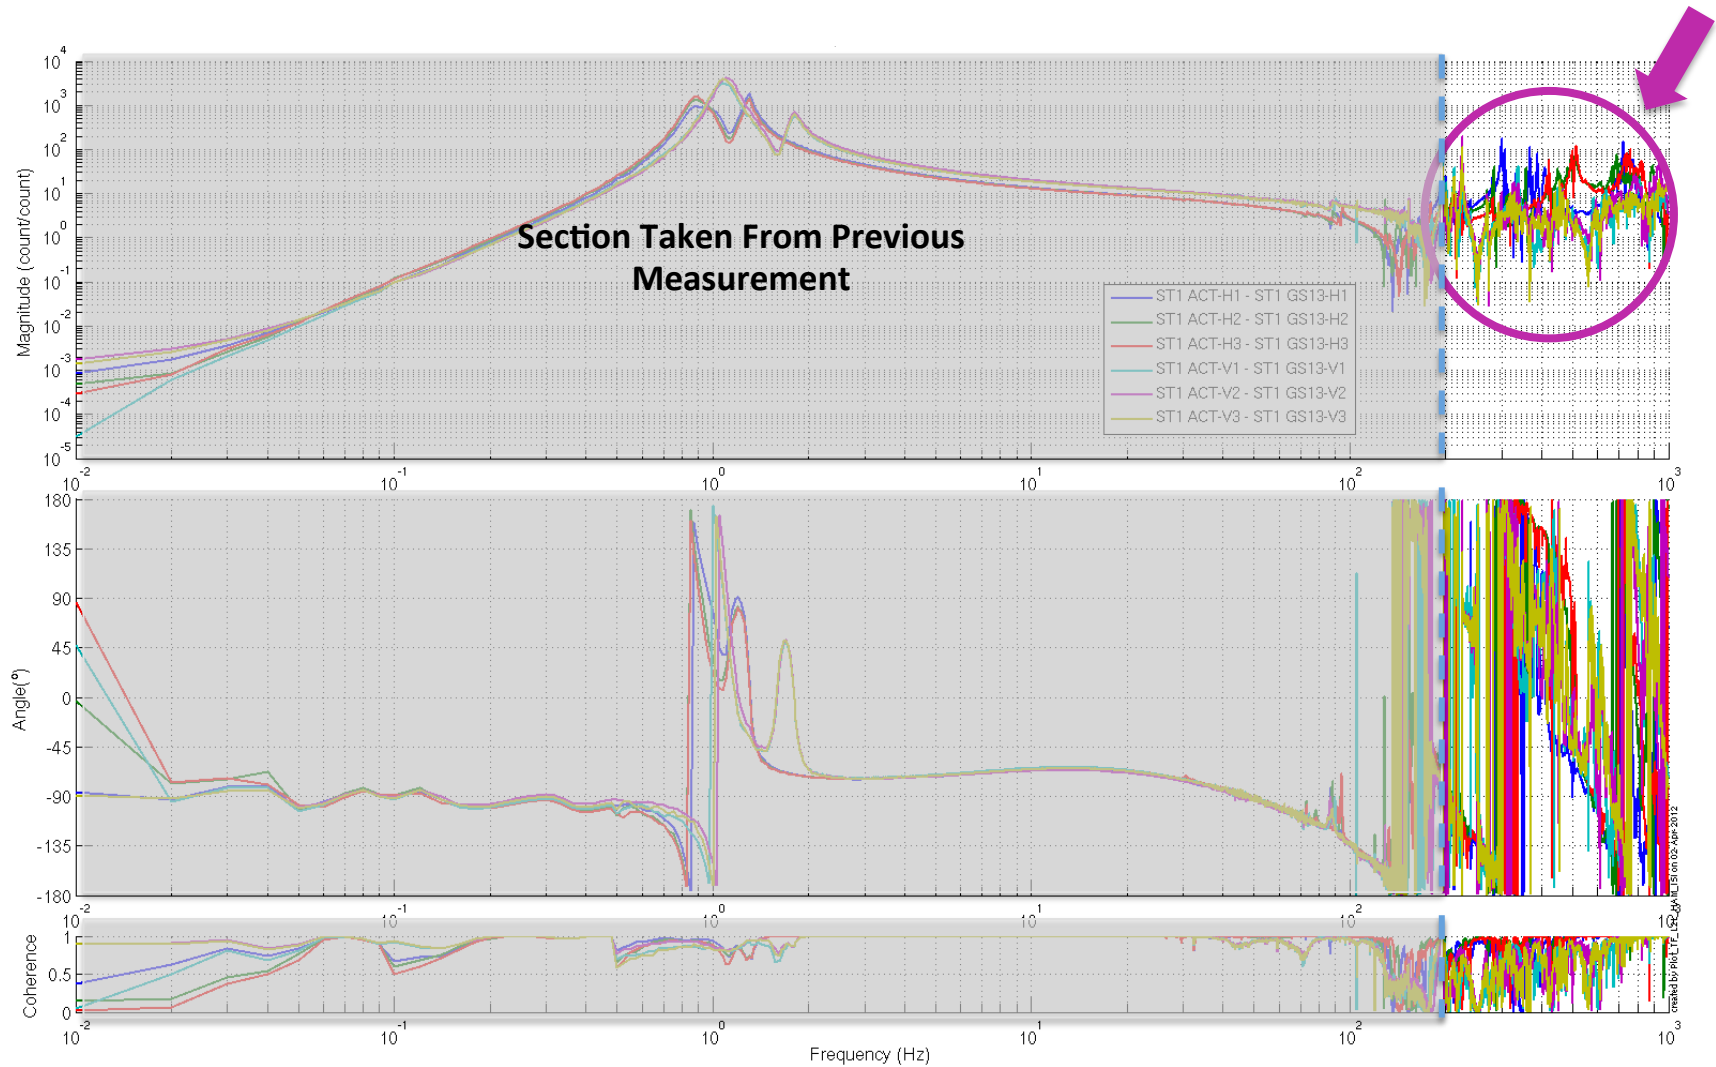

TOP MASS

5 & 10kg
Balancing
Masses

